

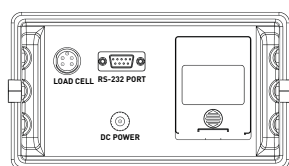


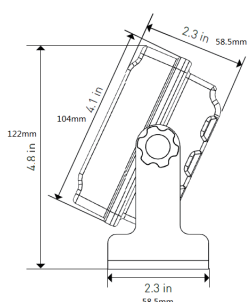

DIMENSIONS

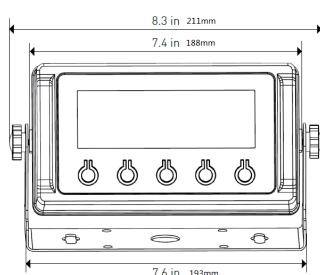

FEATURES

- 1" LCD display with backlight
- Weighing units lb/kg
- Gross/Tare/Pre-Set/Zero/Print
- Multiple Hold functions
- Overload / Underload alarm
- Power saving mode
- 100% manual zero range setting
- Ability to modify gravity based on different geographical locations
- Automatic error warning alarm
- Connects to a remote display
- Connects to OPTIMA printers
- Displays up to 50,000 graduations
- Mounting bracket and hardware included
- Operates on 110V AC adapter (included)
- Full Duplex RS-232 Serial Port
- Drives up to 6 350Ω load cells
- Optional dual load cell ports

ACCESSORIES

- Thermal Ticket Printer
- Label Printer
- Zebra Label Printer
- Remote Display

SPECIFICATIONS:

Display:

LCD; 1in. x 6 digit numeric

Units:

lb, kg

Accuracy Class:

5,000 e

Zero stability error:

TK0 0.1μV//K

Span stability error:

TKspn ± 6 ppm//K

Sensitivity (internal):

0.3 μV / d

Input voltage:

-30 to +30mV DC

Excitation circuit:

3 VDC, 4 wire connection,
6 load cells of 350ohm max

AC power:

AC 100-250V (use only the included
9V adapter supplied)

Operation temperature:

-10 °C ~ +40 °C

Operation humidity:

90%RH

Battery:

3 AA batteries; 110/220VAC

Storage temperature:

-40 °C ~ +70 °C

Weight:

2.2 lb (1 kg)

Internal:

1/2/5/10/20/50

Decimal Points:

Selectable 0, 1, 2, 3, 4 decimal places

Interface:

RS232C

Baud Rate:

1200/2400/4800/9600/14400