

DIGITAL INDICATORS FOR BORE GAUGES (WITH TRANSMISSION BUTTON AND SIGNAL LIGHT)



**INSPECTION
CERTIFICATE**

THE ORIGINAL DATA
REMAINS AFTER POWER OFF


DATA
OUTPUT

- Specially designed for bore gauges
- The minimum value tracking function can find the diameter automatically
- Read the diameter directly, after inputting the size of setting ring
- Reading in digital and analog
- Display can be rotated by 320°
- Button function: on/off, minimum value tracking, calibration, data preset, inch/metric conversion, data output
- Data remains after power off, no need to recalibrate after power on
- Automatic power off (time is adjustable)
- Power:
 - with data interface: CR2032
 - built-in wireless: rechargeable Li-battery
- Optional accessory: backs, contact points



2108-10F


press the button
to transmit data
data transmission
signal light

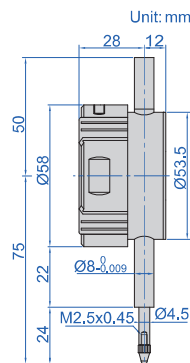

display can
be rotated
by 320°

read the diameter directly,
after inputting the
size of setting ring.

the minimum value
tracking function can find
the diameter automatically.



With data interface

(optional wireless transmitter code 7315-51B, receiver is needed)

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2108-10F*	12.7mm/0.5"	0.002mm/0.0001" (can switch to: 0.01mm/0.0005")	20µm	10µm	1.5N	cannot lift	flat back
2108-101F*	12.7mm/0.5"	0.001mm/0.00005"	5µm	2µm	1.5N	cannot lift	flat back

Built-in wireless (receiver code 7315-2/3/6/7/8/9 is needed)

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2108-10FWL*	12.7mm/0.5"	0.002mm/0.0001" (can switch to: 0.01mm/0.0005")	20µm	10µm	1.5N	cannot lift	flat back
2108-101FWL*	12.7mm/0.5"	0.001mm/0.00005"	5µm	2µm	1.5N	cannot lift	flat back

*Supplied with manufacturer inspection certificate