

DIGITAL INDICATORS (STANDARD TYPE)

**POPULAR
MODEL**




2112-10







2112-251



2112-25P

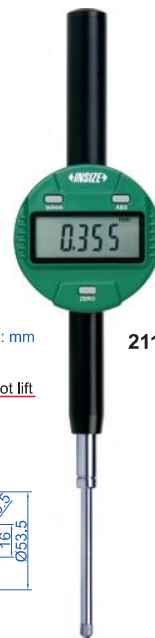

2112-501

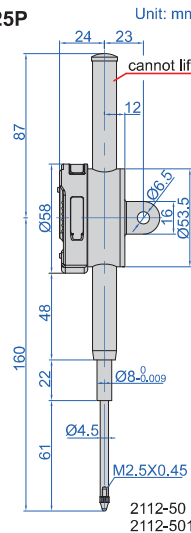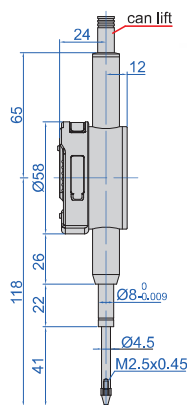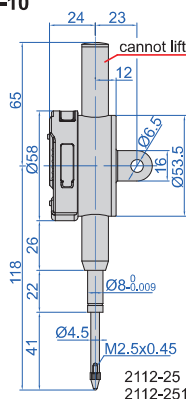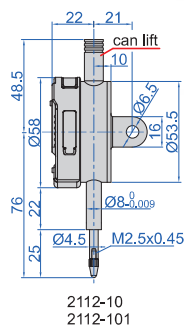

- Button function: on/off, inch/mm, zero, data preset, change measuring direction, absolute/incremental measurement 211
- Switchable high/low frequency measurement mode, high frequency mode is suitable for high speed moving of spindle and has large power consumption, low power consumption in low frequency mode 211
- Keep preset data in memory after restart
- CR2032 battery, automatic power off (time is adjustable)
- Data output
- Optional accessory: wireless transmitter code **7315-50M** (receiver is needed), data output cable code **7302-40M** , **7305-40M** , backs , contact points

Resolution 0.001mm/0.00005"

Code	Range	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2112-101F*	12.7mm/0.5"	5μm	2μm	1.5N	can lift	flat back
2112-251F*	25.4mm/1"	5μm	3μm	2.2N	cannot lift	flat back
2112-501F*	50.8mm/2"	6μm	3μm	2.5N	cannot lift	flat back
2112-101*	12.7mm/0.5"	5μm	2μm	1.5N	can lift	lug back
2112-251*	25.4mm/1"	5μm	3μm	2.2N	cannot lift	lug back
2112-501*	50.8mm/2"	6μm	3μm	2.5N	cannot lift	lug back
2112-251P*	25.4mm/1"	5μm	3μm	2.2N	can lift	flat back
2112-501P*	50.8mm/2"	6μm	3μm	2.5N	can lift	flat back

Resolution 0.01mm/0.0005"

Code	Range	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2112-10F *	12.7mm/0.5"	20μm	10μm	1.5N	can lift	flat back
2112-25F *	25.4mm/1"	20μm	10μm	2.2N	cannot lift	flat back
2112-50F *	50.8mm/2"	30μm	10μm	2.5N	cannot lift	flat back
2112-10 *	12.7mm/0.5"	20μm	10μm	1.5N	can lift	lug back
2112-25 *	25.4mm/1"	20μm	10μm	2.2N	cannot lift	lug back
2112-50 *	50.8mm/2"	30μm	10μm	2.5N	cannot lift	lug back
2112-25P *	25.4mm/1"	20μm	10μm	2.2N	can lift	flat back
2112-50P *	50.8mm/2"	30μm	10μm	2.5N	can lift	flat back



spindle lift knob is included



* Supplied with manufacturer inspection certificate