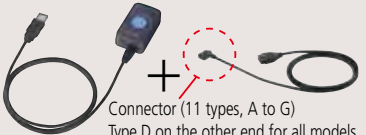




Measuring Tool Compatibility List

Compatibility of USB-ITN and connecting cables with measuring tools

USB Input Tool Direct USB-ITN Select a USB-ITN whose gage connector fits the Digimatic port on your gage 	Connector type		(A) Water-proof type with output button	(B) Water-proof type with output button	(C) Straight type with output button	(CR) L type with output switch (cable outlet is right)
	Model No. Order No.		USB-ITN-A 06AFM380A	USB-ITN-B 06AFM380B	USB-ITN-C 06AFM380C	No applicable models USB-ITN-C is available Refer to the following figure.
IT-016U/IT-007R/DP-1VA LOGGER/MUX-10F/EC Counter Select a cable whose gage connector fits the Digimatic port on your gage  Connector (11 types, A to G) Type D on the other end for all models	Connector type		(A) Water-proof type with output button	(B) Water-proof type with output button	(C) Straight type with output button	(CR) L type with output switch (cable outlet is right)
	Order No.	1 m	05CZA624	05CZA662	959149	04AZB512
		2 m	05CZA625	05CZA663	959150	04AZB513




Gage connectors on data cable	Connector type		(A) Water-proof type with output button	(B) Water-proof type with output button	(C) Straight type with output button	(CR) L type with output switch (cable outlet is right)
	Picture of gage connector					
	Data switch		Available	Available	Available	Available

Digimatic ports on gage	Picture of Digimatic port				
	Applicable models	• Digimatic caliper 500-776/500-777, etc. 500-712-10/500-713-10, etc. 500-712, etc. • 550-301-10/550-331-10, etc. 551-301-10/551-331-10, etc. 552-302-10/552-303-10, etc. 552-150-10/552-151-10, etc. 552-155-10/552-156-10, etc. 552-181-10/552-182-10, etc. • Digimatic special application caliper 573-601/573-602, etc. • Digimatic depth gage 571-251-10/571-252-10, etc. • Digimatic scale unit 572-600, 572-601, etc.	• Digimatic micrometer 293-100-10/293-130-10 293-140-30/293-141-30, etc. 293-230-30/293-240-30, etc. 340-251-30/340-252-30 • Dedicated micrometers for Digimatic 422-230-30/422-231-30, etc. 406-250-30/406-251-30, etc. 343-250-30/343-251-30, etc. 369-250-30/369-251-30, etc. 345-250-30/345-251-30, etc. 314-251-30/314-252-30, etc. • Digimatic micrometer head 350-251-30/350-261-30, etc. • Digimatic holtest 468-161/468-162, etc. • Digimatic depth gage 329-250-30/329-251-30, etc.	• Digimatic caliper 500-150-30/500-151-30, etc. 500-500-10/500-501-10, etc. 500-443, etc. • Digimatic special application caliper 573-118-10/573-119-10, etc. 573-116-10/573-117-10, etc. 573-191-30/573-291-30 573-181-30/573-182-30, etc. • Digimatic depth gage 571-201-30/571-202-30, etc. • Digimatic micrometer head 164-163/164-164 • Digimatic scale unit 572-203-10/572-213-10 572-300-10/572-301-10, etc.  Type C straight connectors can be used. To improve access to the thimble the L type connecting cable can be used with products having the D type input socket, such as the IT-016U, IT-007R, DP-1VA LOGGER, MUX-10F and the EC Counter.	

(D) Flat 10-pin type	(E) Flat 6-pin type	(F) Flat straight type	(FB) Flat L-shape (cable outlet is back)	(FR) Flat L-shape (cable outlet is right)	(FL) Flat L-shape (cable outlet is left)	(G) Flat straight water-proof type
USB-ITN-D 06AFM380D	USB-ITN-E 06AFM380E	USB-ITN-F 06AFM380F	No applicable models USB-ITN-F is available.			USB-ITN-G 06AFM380G
(D) Flat 10-pin type	(E) Round 6-pin type	(F) Flat straight type	(FB) Flat L-shape (cable outlet is back)	(FR) Flat L-shape (cable outlet is right)	(FL) Flat L-shape (cable outlet is left)	(G) Flat straight water-proof type
936937	937387	905338	905689	905691	905693	21EAA194
965014	965013	905409	905690	905692	905694	21EAA190

Note 1: When using ID-F, EB, EC-101D, ID-U, ID-SS, ID-SX with USB-ITN, it is required to use together with USB-ITPAK.
Note 2: USB-ITN and IT-016U cannot be used with EF/EH, VL-50-B/50S-B, and SJ-500/SV-2100.

(D) Flat 10-pin type	(E) Round 6-pin type	(F) Flat straight type	(FB) Flat L-shape (cable outlet is back)	(FR) Flat L-shape (cable outlet is right)	(FL) Flat L-shape (cable outlet is left)	(G) Flat straight water-proof type
						
N/A	N/A	N/A	N/A	N/A	N/A	N/A

						
• Digimatic indicator ID-H ID-F (Note 1) • High-precision height gage QM-Height • Mu-checker Digital Mu-checker (using a foot switch) • Laser scan micrometer LSM-9506 • Linear gage counter EF/EH (Note 2) EB (Note 1), EC-101D (Note 1) • Litematic VL-50-B/50S-B (Note 2) • Contour measuring system SJ-210/310/410 SJ-500/SV-2100 (Note 2) • Hardness testing machines HM-210/220 HV-110/120 HR-530 HR-600	• Digimatic micrometer 293-666-20/293-667-20, etc. 227-201-20/227-221-20, etc. 369-411-20/369-412-20, etc. • Hardness testing machines HM-100 HR-300/400/500 HH-411	• Digimatic indicator ID-CX, ID-C (Peak-Value Hold Type), ID-C (Calculation type), ID-C (Bore Gage Type), ID-U (Note 2), ID-SS (Note 1), ID-SX (Note 1) • Digimatic height gage 192-663-10/192-613-10/570-322/570-227, etc. (Flat L-shape, cable outlet is right) • ABS borematic 568-361/568-362, etc. • Scale unit 572-460/572-560/572-480-10/572-580-10, etc.	• Digimatic bore gage 511-501/511-502, etc. • Hardness testing machines HH-300	• Digimatic depth gage Digimatic type (ID-CX)		• Digimatic indicator ID-N ID-B